



Parcel 004 (D-1)
VDOT Project #0122-033-103-R201
Corner of Routes 122 and 670
Burnt Chimney, Franklin County, Virginia

Task Number: SA0043

ASBESTOS INSPECTION REPORT County of Franklin Property

Prepared For:
Virginia Department of Transportation
P.O. Box 3071
Salem, Virginia 24153

Prepared By:
EnviroCheck of Virginia, Inc.
375 Mountain Lane
Tazewell, Virginia 24651

Under Contract To:
EEE Consulting, Inc.
201 Church Street, Suite C
Blacksburg, Virginia 24060

Project #E3-18

e²C EnviroCheck of Virginia, Inc.
"Energy, Environmental Consulting"

<u>TABLE OF CONTENTS</u>	<u>PAGE</u>
1.0 INTRODUCTION	1
2.0 ASBESTOS-CONTAINING MATERIAL DEFINED.....	1
3.0 ASBESTOS INSPECTION.....	2
4.0 ANALYTICAL METHODS.....	4
5.0 CONFIRMED ASBESTOS-CONTAINING MATERIAL.....	5
6.0 CONCLUSIONS/RECOMMENDATIONS.....	6

APPENDICES

APPENDIX I

VDOT Location Sheet and Building Diagram

APPENDIX II

Photodocumentation

APPENDIX III

Laboratory Analyses/Chain of Custody Forms

APPENDIX IV

Laboratory Accreditation

APPENDIX V

Inspectors License

APPENDIX VI

Abatement Cost Estimate

1.0 INTRODUCTION

EnviroCheck of Virginia, Inc. (EC) is pleased to present the Virginia Department of Transportation (VDOT) Salem District Environmental Section with the results of an asbestos inspection conducted on a residential structure currently owned by ~~The County of~~ ^{ROST} ~~JB~~ Franklin. The house is located at the Corner of Routes 122 and 670, Burnt Chimney, Virginia. The structure inspected consisted of a two story, rock/wood frame house and carport.

A VDOT location sheet depicting the location of the structure is provided in **Appendix I**. A building diagram is provided in **Appendix I** and photodocumentation is provided in **Appendix II** depicting the house.

The scope of services for the project included the following:

- The identification and representative sampling (as necessary) of suspected asbestos-containing materials (ACM);
- The classification of any ACM including its condition and estimated volume;
- The preparation of a report outlining the inspection procedures and laboratory analyses, amount of ACM found, and estimated cost for ACM removal; and
- The presentation of information necessary to comply with the Environmental Protection Agency (EPA) National Emission Standards for Hazardous Air Pollutants (NESHAP) asbestos regulations and for building demolition.

2.0 ASBESTOS-CONTAINING MATERIAL DEFINED

According to NESHAP (40 CFR subpart M, part 61) asbestos regulations, materials found to contain asbestos fibers may be categorized as follows:

Category I Non-friable – Category I ACM includes asbestos-containing gaskets, packings, resilient floor coverings, resilient floor covering mastic, and asphalt roofing products containing more than one percent asbestos. Asphalt roofing products, which may contain asbestos, include built-up roofing; asphalt containing single ply membrane systems; asphalt shingles; asphalt containing underlayment felts; asphalt containing roof coatings and mastics; and asphalt containing base flashings. ACM roofing products that use other bituminous or resinous binders

(such as coal tars or pitches) are also considered to be Category I ACM.

Category II Non-friable – Category II ACM includes all other non-friable ACM, for example, asbestos-cement (A/C) shingles, A/C tiles, and transite boards or panels containing more than one percent asbestos. Generally speaking, Category II ACM is more likely to become friable when damaged than is Category I ACM. The applicability of the NESHAP to Category I and II ACM depends on: (1) the condition of the material at the time of demolition or renovation, (2) the nature of the operation to which the material will be subjected, and (3) the amount of ACM involved.

Friable ACM – Friable ACM is ACM that, when dry, can be crumbled, pulverized or reduced to powder by hand pressure.

Regulated Asbestos-Containing Material (RACM) ACM regulated under the NESHAP is referred to as "regulated asbestos-containing material" (RACM). RACM is defined in § 61.141 of the NESHAP and includes: (1) friable ACM; (2) Category I non-friable ACM that has become friable; (3) Category I non-friable ACM that has been or will be sanded, ground, cut, or abraded; or (4) Category II non-friable ACM that has already been or is likely to become crumbled, pulverized, or reduced to powder. If the coverage threshold for RACM is met or exceeded in a renovation or demolition operation, then all friable ACM in the operation, and in certain situations, non-friable ACM in the operation, are subject to the NESHAP (A) Threshold Amounts of Asbestos-Containing Roofing Material.

The NESHAP asbestos regulations specify that Category I materials that are not in poor condition and are not friable prior to demolition do not have to be removed, except where demolition will be by intentional burning. However, RACM, and Category II materials that have a high probability of being crumbled, pulverized, or reduced to powder, as part of demolition must be removed before demolition begins.

3.0 ASBESTOS INSPECTION

A Virginia-licensed asbestos inspector from EC conducted an asbestos inspection of the structure on June 9, 2008. Suspected ACM were evaluated according to whether the materials were damaged (poor) or non-damaged (good) condition at the time of inspection.

Table 1 – Microscopy Results, presents the condition and NESHAP category of all materials confirmed to contain asbestos. Areas containing homogenous materials were identified and sampled accordingly. Homogeneous materials are defined as being uniform in texture and color and appearing identical in every other aspect. Additionally, as part of

the scope of services for this project, the area or length of the sampled material was estimated. The homogeneous areas defined in each building are summarized as follows:

County of Franklin – D-1

- 01, 02, 03 – Kitchen Layer 1 and 2 Linoleum (unable to separate layers)
- 04, 05, 06 – Kitchen Layer 3 Tile
- 07, 08, 09 – Wall Plaster
- 10, 11, 12 – Ceiling Plaster
- 13, 14, 15 – Duct Tape
- 16, 17, 18 – Window Glaze
- 19, 20, 21 – Window Caulk
- 22, 23, 24 – Sink Caulk
- 25, 26, 27 – Sink Backboard Glue
- 28, 29, 30 – 2nd Layer DW
- 31, 32, 33 – DR Ceiling Texture
- 34, 35, 36 – LR Plaster/Ceiling Texture
- 37, 38, 39 – Wall Texture
- 40, 41, 42 – Insulation
- 43, 44, 45 – BR #1 Ceiling Texture
- 46, 47, 48 – BR #1 Wallboard
- 49, 50, 51 – Bath Tile and Glue
- 52, 53, 54 – Wall Tile Glue
- 55, 56, 57 – Tub Caulk
- 58, 59, 60 – Ceiling Plaster
- 61, 62, 63 – Pantry Glue
- 64, 65, 66 – Pantry Ceiling
- 67, 68, 69 – Hallway Linoleum Under Tile
- 70, 71, 72 – FR Linoleum
- 73, 74, 75 – FR Wall/Ceiling Plaster
- 76, 77, 78 – Bath Ceiling Texture

79, 80, 81 – Sink Caulk
82, 83, 84 – BR #2 CB
85, 86, 87 – WP BR#2
88, 89, 90 – BR #3 CB
91, 92, 93 – Upstairs Entry C. Board
94, 95, 96 – WP
97, 98, 99 – Carpet Padding
100, 101, 102 – Window Glaze
103, 104, 105 – Lower Chimney Sealant
106, 107, 108 – Aluminum Caulk
109, 110, 111 – Black Sealant
112, 113, 114 – Eve/Chimney Sealant/Flashing
115, 116, 117 – Window Glaze
118, 119, 120 – Wood/Black Caulk
121, 122, 123 – Small Back Window Glaze
124, 125, 126 – TP
127, 128, 129 – Old Caulk Behind Aluminum Flashing
130, 131, 132 – Duct Tape Furnace

4.0 ANALYTICAL METHODS

EC submitted a total of 132 samples (44 materials) to AmeriSci Laboratories of Richmond, Virginia for analysis. The analytical method used by the laboratory for sample identification was EPA Method 600/R-93/116 and EPA/600/M4-82/020 – Polarized Light Microscopy (PLM) coupled with Dispersion Staining. AmeriSci of Midlothian, Virginia is accredited by the National Voluntary Laboratory Accreditation Program (NVLAP No. 101904). Certificates of analyses are located in **Appendix III**, proof of laboratory accreditation is provided in **Appendix IV** and a copy of the Inspector's License is provided in **Appendix V**.

5.0 CONFIRMED ASBESTOS-CONTAINING MATERIAL

The laboratory confirmed that six of the materials collected from the house are comprised of greater than 1% asbestos. The location of this material within the building is depicted on the Building Diagram provided in **Appendix I**. The location, category, condition, and estimated length or area of each positive sample is summarized in **Table 1**.

TABLE 1
POSITIVE MICROSCOPY RESULTS
County of Franklin (D-1)
VDOT Project #0122-033-103-R201

Sample ID	Sample Description	Percent & Asbestos Type	NESHAP Category	Condition	Approx. Quantity	VDOT Spec.
D-1 - 1, 2, 3	Kitchen Layer 1 and 2 Linoleum (two materials) ¹	10%/10% Chrysotile	Category I Non-Friable	Good	360 ft ²	Neshap Demo
D-1 - 100, 101, 102	Window Glaze ²	4% Chrysotile	Category II Non-Friable	Good	128 L.F.	Abate
D-1 - 109, 110, 111	Black Sealant ³	17% Chrysotile	Category I Non-Friable	Good	60 ft ²	Neshap Demo
D-1 - 112, 113, 114	Eve/Chimney Sealant/Flashing ⁴	5% Chrysotile	Category I Non-Friable	Good	176 ft ²	Neshap Demo
D-1 - 115, 116, 117	Window Glaze ⁵	4% Chrysotile	Category II Non-Friable	Good	30 L.F.	Abate

Legend:

- 1 - Material is in two layers, estimate includes twice the footage of the kitchen.
- 2 - All upstairs windows that have not been replaced.
- 3 - Material along ridge of house beneath the wood shingles.
- 4 - Material is on chimneys and flashing along dormers and at roof breaks with porches.
- 5 - Small window in furnace room.

Note: Contractor should verify units, quantities are estimates only.

The total quantity of materials comprised of greater than 1% (per building) asbestos is summarized in **Table 2**.

TABLE 2
CONTRACT PAY ITEMS
County of Franklin Property

Building Description	Total Quantity of Materials	NESHAP Category	Unit	VDOT Spec.
D-1	4	Category I Non-Regulated	596 ft ²	Neshap Demo
D-1	2	Category II Regulated	158 L.F.	Abate

6.0 CONCLUSIONS/RECOMMENDATIONS

Results of the asbestos inspection conducted on the County of Franklin structure indicates that six ACM's were identified of greater than 1% asbestos. The material was in good condition on the day of the inspection.

APPENDIX I
Building Diagram

**Franklin County Property
Corner of Routes 122 and 670**

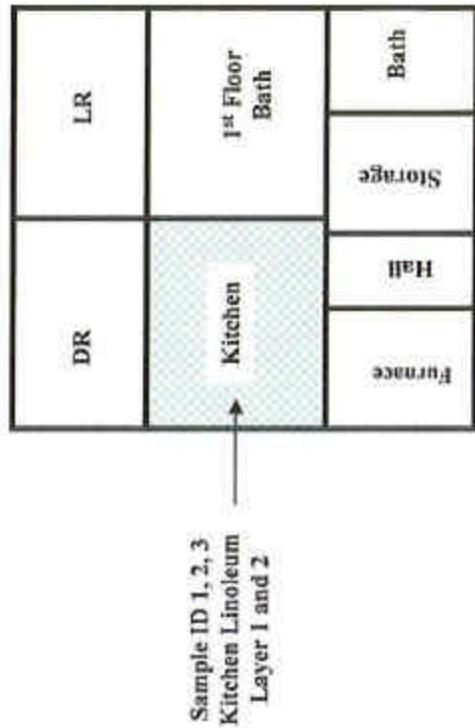


Figure:	Building Diagram
Client:	VDOT
Site:	Burnt Chimney, VA
Date:	6/08

e2C EnviroCheck of Virginia, Inc.
"Energy. Environmental Consulting"

Franklin County Property
Corner of Routes 122 and 670
Roof View

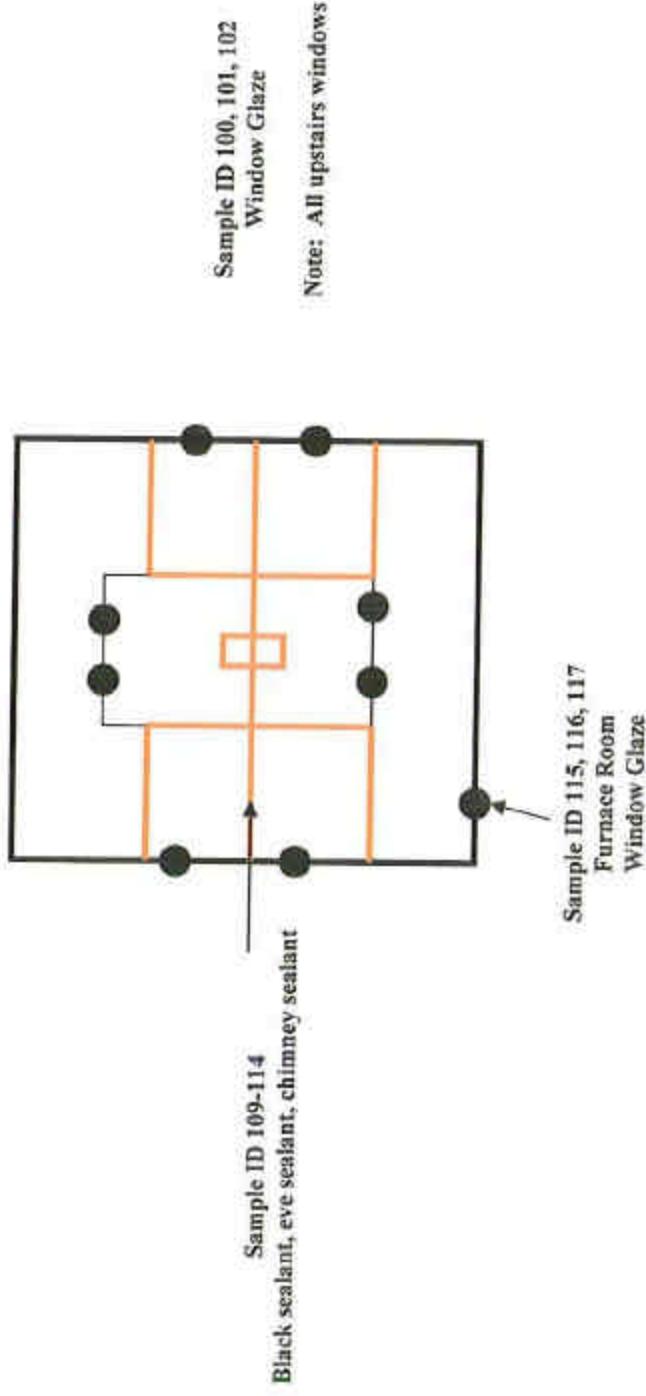


Figure:	Building Diagram
Client:	VDOT
Site:	Burnt Chimney, VA
Date:	6/08

e²C EnviroCheck of Virginia, Inc.
"Energy. Environmental Consulting"

APPENDIX II
Photodocumentation

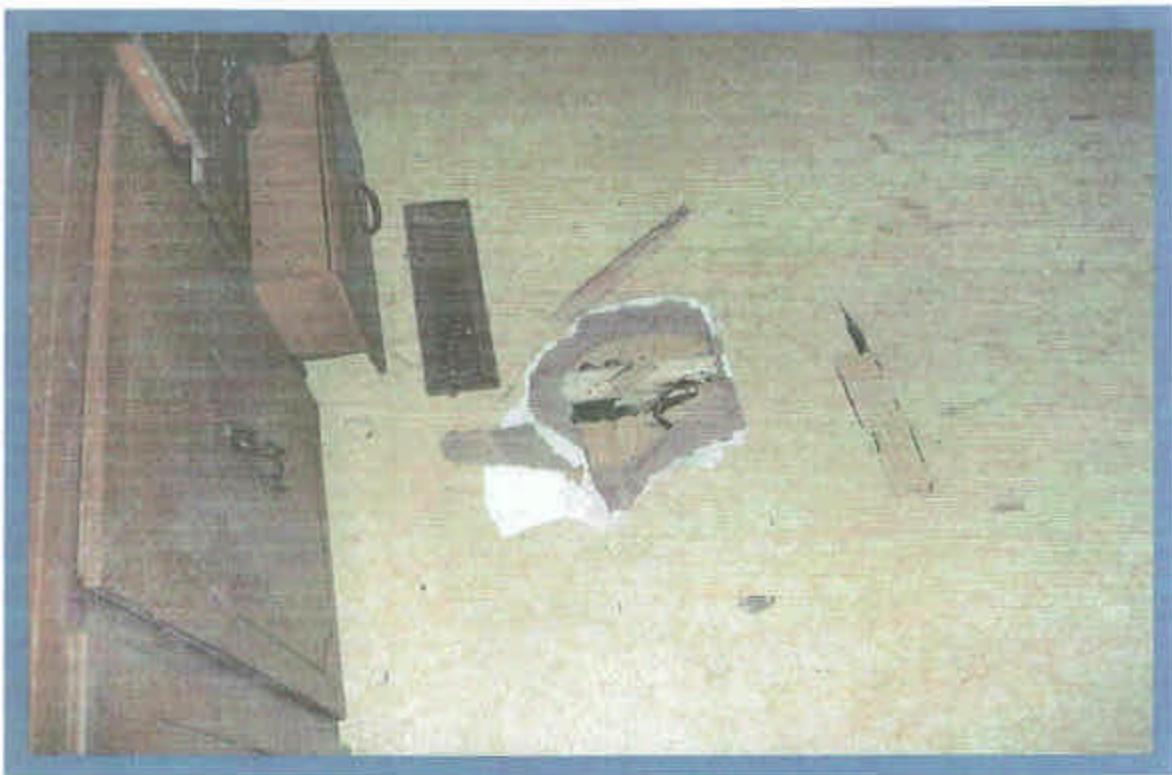


Photo 1: Sample ID 1, 2, 3 – Kitchen layers 1 and 2 (unable to separate).



Photo 2: Sample ID 100, 101, 102 – Upstairs window glaze.



Photo 3: Sample ID 109, 110, 111 – Black sealant at roof peak, chimneys, porches, and dormers.



Photo 4: Sample ID 112, 113, 114 – Chimney sealant.

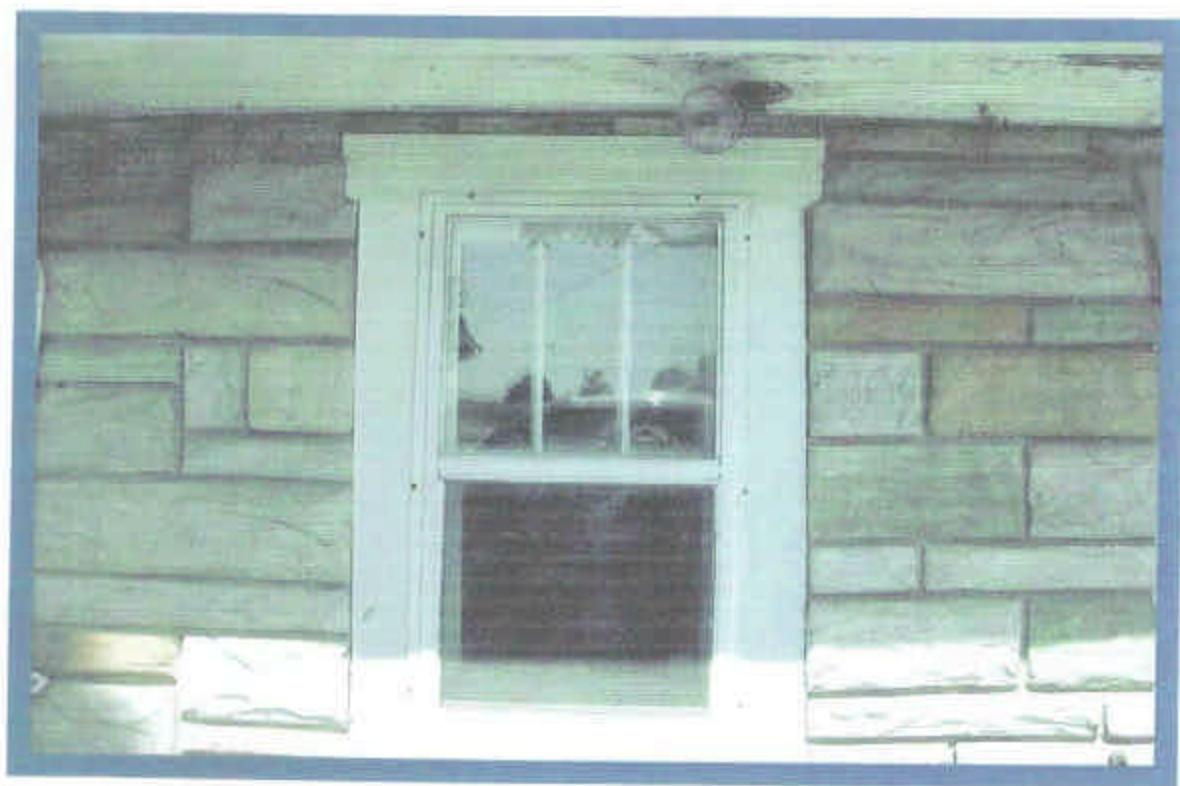


Photo 5: Sample ID 115, 116, 117 – Furnace room window glaze.

APPENDIX III
*Laboratory Analyses/
Chain-of-Custody Form*



Please Reply To:

AmeriSci Richmond

13635 GENITO ROAD
MIDLOTHIAN, VIRGINIA 23112
TEL: (804) 763-1200 • FAX: (804) 763-1800

FACSIMILE TELECOPY TRANSMISSION

To: J.L. Rhudy III
Envirocheck, LLC
Fax #:
Email: jlleslie1@earthlink.net

From: Glenn F. Massey
AmeriSci Job #: 108061349
Subject: PLM 5 day Results
Client Project: E3-20; County of Franklin; D-1,
Parcel 004 County of Franklin

Date: Monday, June 16, 2008
Time: 10:54:12
Comments:

Number of Pages: 129
(including cover sheet)

CONFIDENTIALITY NOTICE: Unless otherwise indicated, the information contained in this communication is confidential information intended for use of the individual named above. If the reader of this communication is not the intended recipient, you are hereby notified that any dissemination, distribution or copying of this communication is prohibited. If you have received this communication in error, please immediately notify the sender by telephone and return the original message to the above address via the US Postal Service at our expense. Preliminary data reported here will be verified before final report is issued. Samples are disposed of in 60 days or unless otherwise instructed by the protocol or special instructions in writing. Thank you.

*Certified Analysis Service 24 Hours A Day * 7 Days A Week Competitive Prices*
visit our web site - www.amerisci.com

Boston • Los Angeles • New York • Richmond



AmeriSci Richmond

13635 GENITO ROAD
MIDLOTHIAN, VIRGINIA 23112
TEL: (804) 763-1200 • FAX: (804) 763-1800

PLM Bulk Asbestos Report

Envirocheck, LLC
Attn: J.L. Rhudy III
375 Mountain Road

Tazewell, VA 24651

Date Received 06/11/08 AmeriSci Job # 108061349
Date Examined 06/14/08 P.O. #
Page 1 of 26
RE: E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-1 1	108061349-01L1 Location: K. Layer 1 & 2 Linoleum	Yes	10 % (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Tan/Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Chrysotile 10.0 % Other Material: Cellulose 20 %, Non-fibrous 70 %			
D-1-1 1	108061349-01L2 Location: K. Layer 1 & 2 Linoleum	Yes	10 % (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Chrysotile 10.0 % Other Material: Cellulose 20 %, Non-fibrous 70 %			
D-1-1 1	108061349-01L3 Location: K. Layer 1 & 2 Linoleum (Sub-Floor)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Brown, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %			
D-1-2 1	108061349-02.1 Location: K. Layer 1 & 2 Linoleum		NA/PS
Analyst Description: Bulk Material Asbestos Types: Other Material:			
D-1-2 1	108061349-02.2 Location: K. Layer 1 & 2 Linoleum (Sub-Floor)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Brown, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %			

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-3 1	108061349-03.1 Location: K. Layer 1 & 2 Linoleum		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		
D-1-3 1	108061349-03.2 Location: K. Layer 1 & 2 Linoleum (Sub-Floor)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Brown, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		
D-1-4 2	108061349-04L1 Location: K. Layer 3 Tile	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Tan, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 25 %, Non-fibrous 75 %		
D-1-4 2	108061349-04L2 Location: K. Layer 3 Tile (Paper)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Black, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 60 %, Synthetic fibers 20 %, Non-fibrous 20 %		
D-1-5 2	108061349-05L1 Location: K. Layer 3 Tile	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Tan, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 25 %, Non-fibrous 75 %		
D-1-5 2	108061349-05L2 Location: K. Layer 3 Tile (Paper)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Black, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 60 %, Synthetic fibers 20 %, Non-fibrous 20 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-6 2	108061349-06L1 Location: K. Layer 3 Tile	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Tan, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 25 %, Non-fibrous 75 %			
D-1-6 2	108061349-06L2 Location: K. Layer 3 Tile (Paper)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Black, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 60 %, Synthetic fibers 20 %, Non-fibrous 20 %			
D-1-7 3	108061349-07 Location: Wall Plaster	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Off White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			
D-1-8 3	108061349-08 Location: Wall Plaster	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Off White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %			
D-1-9 3	108061349-09 Location: Wall Plaster	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Off White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %			
D-1-10 4	108061349-10 Location: Ceiling Plaster	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-11 4	108061349-11 Location: Ceiling Plaster	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
		Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %	
D-1-12 4	108061349-12 Location: Ceiling Plaster	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
		Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %	
D-1-13 5	108061349-13 Location: Duct Tape	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
		Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Synthetic fibers 25 %, Non-fibrous 75 %	
D-1-14 5	108061349-14 Location: Duct Tape	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
		Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Synthetic fibers 25 %, Non-fibrous 75 %	
D-1-15 5	108061349-15 Location: Duct Tape	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
		Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Synthetic fibers 25 %, Non-fibrous 75 %	
D-1-16 6	108061349-16 Location: Window Glaze	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
		Analyst Description: Off White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %	

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-17 6	108061349-17 Location: Window Glaze	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Off White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-18 6	108061349-18 Location: Window Glaze	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Off White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-19 7	108061349-19 Location: Window Caulk	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-20 7	108061349-20 Location: Window Caulk	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-21 7	108061349-21 Location: Window Caulk	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-22 8	108061349-22 Location: Sink Caulk	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Off White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		

See Reporting notes on last page

Client Name: Envirocheck, LLC

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-23 8	108061349-23 Location: Sink Caulk	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Off White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-24 8	108061349-24 Location: Sink Caulk	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Off White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-25 9	108061349-25 Location: Sink Backboard Glue	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Tan, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-26 9	108061349-26 Location: Sink Backboard Glue	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Tan, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-27 9	108061349-27 Location: Sink Backboard Glue	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Tan, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-28 10	108061349-28 Location: 2nd Layer DW	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 10 %, Non-fibrous 90 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-29 10	108061349-29 Location: 2nd Layer DW	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 5 %, Non-fibrous 95 %		
D-1-30 10	108061349-30 Location: 2nd Layer DW	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 5 %, Non-fibrous 95 %		
D-1-31 11	108061349-31 Location: DR Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-32 11	108061349-32 Location: DR Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-33 11	108061349-33 Location: DR Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-34 12	108061349-34 Location: LR Plaster/Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-35 12	108061349-35 Location: LR Plaster/Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-36 12	108061349-36.1 Location: LR Plaster/Ceiling Texture (Base Coat)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Gray, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-36 12	108061349-36.2 Location: LR Plaster/Ceiling Texture (White Coat)	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-37 13	108061349-37 Location: Wall Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-38 13	108061349-38 Location: Wall Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-39 13	108061349-39 Location: Wall Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: White, Homogeneous, Non-Fibrous, Cementitious, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-40 14	108061349-40 Location: Insulation	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %			
D-1-41 14	108061349-41 Location: Insulation	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %			
D-1-42 14	108061349-42 Location: Insulation	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: Gray, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %			
D-1-43 15	108061349-43 Location: BR #1 Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			
D-1-44 15	108061349-44 Location: BR #1 Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			
D-1-45 15	108061349-45 Location: BR #1 Ceiling Texture	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
Analyst Description: White, Homogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-46 16	108061349-46 Location: BR #1 Wall Board	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Gray/Brown, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 15 %, Fibrous glass 3 %, Non-fibrous 82 %		
D-1-47 16	108061349-47 Location: BR #1 Wall Board	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Gray/Brown, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 15 %, Fibrous glass 3 %, Non-fibrous 82 %		
D-1-48 16	108061349-48 Location: BR #1 Wall Board	No	NAD (by CVES) by Glenn F. Massey on 06/14/08
	Analyst Description: Gray/Brown, Homogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 15 %, Fibrous glass 3 %, Non-fibrous 82 %		
D-1-49 17	108061349-49L1 Location: Bath Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/14/08
	Analyst Description: Lt. Gray, Heterogeneous, Non-Fibrous, Floor Tile Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-49 17	108061349-49L2 Location: Bath Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/14/08
	Analyst Description: Yellow, Heterogeneous, Non-Fibrous, Mastic Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-50 17	108061349-50L1 Location: Bath Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Lt. Gray, Heterogeneous, Non-Fibrous, Floor Tile Asbestos Types: Other Material: Non-fibrous 100 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-50 17	108061349-50L2 Location: Bath Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow, Heterogeneous, Non-Fibrous, Mastic Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-51 17	108061349-51L1 Location: Bath Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Lt. Gray, Heterogeneous, Non-Fibrous, Floor Tile Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-51 17	108061349-51L2 Location: Bath Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow, Heterogeneous, Non-Fibrous, Mastic Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-52 18	108061349-52 Location: Wall Tile Glue	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-53 18	108061349-53 Location: Wall Tile Glue	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-54 18	108061349-54 Location: Wall Tile Glue	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown/White/Grey, Heterogeneous, Non-Fibrous, Composite Asbestos Types: Other Material: Non-fibrous 100 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-55 19	108061349-55 Location: Tub Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-56 19	108061349-56 Location: Tub Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-57 19	108061349-57 Location: Tub Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-58 20	108061349-58 Location: Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-59 20	108061349-59 Location: Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-60 20	108061349-60 Location: Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-61 21	108061349-61 Location: Plaster Glue	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow/Tan, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 3 %, Non-fibrous 97 %		
D-1-62 21	108061349-62 Location: Plaster Glue	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow/Tan, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-63 21	108061349-63 Location: Plaster Glue	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow/Tan, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-64 22	108061349-64 Location: Pantry Ceiling	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-65 22	108061349-65 Location: Pantry Ceiling	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-66 22	108061349-66 Location: Pantry Ceiling	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-67 23	108061349-67 Location: Hallway Linoleum Under Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 93 %, Non-fibrous 7 %		
D-1-68 23	108061349-68 Location: Hallway Linoleum Under Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 93 %, Non-fibrous 7 %		
D-1-69 23	108061349-69 Location: Hallway Linoleum Under Tile	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 93 %, Non-fibrous 7 %		
D-1-70 24	108061349-70L1 Location: FR Linoleum	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Non-Fibrous, Linoleum Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-70 24	108061349-70L2 Location: FR Linoleum	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow, Heterogeneous, Non-Fibrous, Mastic Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-71 24	108061349-71L1 Location: FR Linoleum	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Non-Fibrous, Linoleum Asbestos Types: Other Material: Non-fibrous 100 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-71 24	108061349-71L2 Location: FR Linoleum	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow, Heterogeneous, Non-Fibrous, Mastic Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-72 24	108061349-72L1 Location: FR Linoleum	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Non-Fibrous, Linoleum Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-72 24	108061349-72L2 Location: FR Linoleum	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Yellow, Heterogeneous, Non-Fibrous, Mastic Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-73 25	108061349-73.1 Location: FR Wall/Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Skimcoat (Plaster) Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-73 25	108061349-73.2 Location: FR Wall/Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Grey, Heterogeneous, Fibrous, Cementitious, Base Coat (Plaster) Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-74 25	108061349-74.1 Location: FR Wall/Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Skimcoat (Plaster) Asbestos Types: Other Material: Non-fibrous 100 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-74 25	108061349-74.2 Location: FR Wall/Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: Grey, Heterogeneous, Fibrous, Cementitious, Base Coat (Plaster)			
Asbestos Types:			
Other Material: Cellulose 2 %, Non-fibrous 98 %			
D-1-75 25	108061349-75.1 Location: FR Wall/Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: White, Heterogeneous, Non-Fibrous, Skimcoat (Plaster)			
Asbestos Types:			
Other Material: Non-fibrous 100 %			
D-1-75 25	108061349-75.2 Location: FR Wall/Ceiling Plaster	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: Grey, Heterogeneous, Fibrous, Cementitious, Base Coat (Plaster)			
Asbestos Types:			
Other Material: Cellulose 3 %, Non-fibrous 97 %			
D-1-76 26	108061349-76.1 Location: Bath Ceiling Texture	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: White, Heterogeneous, Non-Fibrous, Textured Ceiling			
Asbestos Types:			
Other Material: Non-fibrous 100 %			
D-1-76 26	108061349-76.2 Location: Bath Ceiling Texture	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: Grey, Heterogeneous, Fibrous, Cementitious, Base Coat (Plaster)			
Asbestos Types:			
Other Material: Cellulose 2 %, Non-fibrous 98 %			
D-1-77 26	108061349-77.1 Location: Bath Ceiling Texture	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: White, Heterogeneous, Non-Fibrous, Ceiling Texture			
Asbestos Types:			
Other Material: Non-fibrous 100 %			

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-77 26	108061349-77.2 Location: Bath Ceiling Texture	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Gray, Heterogeneous, Fibrous, Cementitious, Base Coat (Plaster) Asbestos Types: Other Material: Cellulose 3 %, Non-fibrous 97 %		
D-1-78 26	108061349-78.1 Location: Bath Ceiling Texture	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Ceiling Texture Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-78 26	108061349-78.2 Location: Bath Ceiling Texture	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Grey, Heterogeneous, Fibrous, Cementitious, Base Coat (Plaster) Asbestos Types: Other Material: Cellulose 3 %, Non-fibrous 97 %		
D-1-79 27	108061349-79 Location: Sink Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-80 27	108061349-80 Location: Sink Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-81 27	108061349-81 Location: Sink Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-82 28	108061349-82 Location: BR #2 CB	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-83 28	108061349-83 Location: BR #2 CB	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-84 28	108061349-84 Location: BR #2 CB	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-85 29	108061349-85 Location: WP - BR #2	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Lt. Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		
D-1-86 29	108061349-86 Location: WP - BR #2	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Lt. Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		
D-1-87 29	108061349-87 Location: WP - BR #2	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Lt. Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-88 30	108061349-88 Location: BR #3 CB	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-89 30	108061349-89 Location: BR #3 CB	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-90 30	108061349-90 Location: BR #3 CB	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-91 31	108061349-91 Location: Upstairs Entry C. Board	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 96 %, Non-fibrous 4 %		
D-1-92 31	108061349-92 Location: Upstairs Entry C. Board	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 96 %, Non-fibrous 4 %		
D-1-93 31	108061349-93 Location: Upstairs Entry C. Board	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 96 %, Non-fibrous 4 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-94 32	108061349-94 Location: WP	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		
D-1-95 32	108061349-95 Location: WP	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Red/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		
D-1-96 32	108061349-96 Location: WP	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Green/Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 95 %, Non-fibrous 5 %		
D-1-97 33	108061349-97 Location: Carpet Padding	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Synthetic fibers 97 %, Non-fibrous 3 %		
D-1-98 33	108061349-98 Location: Carpet Padding	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Synthetic fibers 97 %, Non-fibrous 3 %		
D-1-99 33	108061349-99 Location: Carpet Padding	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Brown, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Synthetic fibers 97 %, Non-fibrous 3 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-100 34	108061349-100 Location: Window Glaze	Yes	4 % (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Chrysotile 4.0 % Other Material: Non-fibrous 96 %		
D-1-101 34	108061349-101 Location: Window Glaze		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		
D-1-102 34	108061349-102 Location: Window Glaze		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		
D-1-103 35	108061349-103 Location: Lower Chimney Sealant	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Dark Gray, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-104 35	108061349-104 Location: Lower Chimney Sealant	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Dark Gray, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		
D-1-105 35	108061349-105 Location: Lower Chimney Sealant	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Dark Gray, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose Trace, Non-fibrous 100 %		

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-106 36	108061349-106 Location: AL Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			
D-1-107 36	108061349-107 Location: AL Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			
D-1-108 36	108061349-108 Location: AL Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %			
D-1-109 37	108061349-109 Location: Black Sealant	Yes	17 % (by CVES) by David W. Ralbovsky on 06/16/08
Analyst Description: Black, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Chrysotile 17.0 % Other Material: Non-fibrous 83 %			
D-1-110 37	108061349-110 Location: Black Sealant		NA/PS
Analyst Description: Bulk Material Asbestos Types: Other Material:			
D-1-111 37	108061349-111 Location: Black Sealant		NA/PS
Analyst Description: Bulk Material Asbestos Types: Other Material:			

See Reporting notes on last page.

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-112 38	108061349-112 Location: Eve/Chimney Sealant/Flashing	Yes	5 % (by CVES) by David W. Ralovsky on 06/16/08
	Analyst Description: Grey/Black, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Chrysotile 5.0 % Other Material: Cellulose 10 %, Non-fibrous 85 %		
D-1-113 38	108061349-113 Location: Eve/Chimney Sealant/Flashing		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		
D-1-114 38	108061349-114 Location: Eve/Chimney Sealant/Flashing		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		
D-1-115 39	108061349-115 Location: Window Glaze	Yes	4 % (by CVES) by David W. Ralovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Chrysotile 4.0 % Other Material: Non-fibrous 96 %		
D-1-116 39	108061349-116 Location: Window Glaze		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		
D-1-117 39	108061349-117 Location: Window Glaze		NA/PS
	Analyst Description: Bulk Material Asbestos Types: Other Material:		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-118 40	108061349-118 Location: Wood/Block Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Tan, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-119 40	108061349-119 Location: Wood/Block Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Tan, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-120 40	108061349-120 Location: Wood/Block Caulk	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Tan, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-121 41	108061349-121 Location: Small Back Window Glaze	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-122 41	108061349-122 Location: Small Back Window Glaze	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		
D-1-123 41	108061349-123 Location: Small Back Window Glaze	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Non-fibrous 100 %		

See Reporting notes on last page

PLM Bulk Asbestos Report

E3-20; County of Franklin; D-1, Parcel 004 County of Franklin

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
D-1-124 42	108061349-124 Location: TP	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Black, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-125 42	108061349-125 Location: TP	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Black, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-126 42	108061349-126 Location: TP	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: Black, Heterogeneous, Fibrous, Bulk Material Asbestos Types: Other Material: Cellulose 97 %, Non-fibrous 3 %		
D-1-127 43	108061349-127 Location: Old Caulk Behind AL Flashing	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Fibrous Talc 2 %, Non-fibrous 98 %		
D-1-128 43	108061349-128 Location: Old Caulk Behind AL Flashing	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Fibrous Talc 2 %, Non-fibrous 98 %		
D-1-129 43	108061349-129 Location: Old Caulk Behind AL Flashing	No	NAD (by CVES) by David W. Ralbovsky on 06/16/08
	Analyst Description: White, Heterogeneous, Non-Fibrous, Bulk Material Asbestos Types: Other Material: Fibrous Talc 2 %, Non-fibrous 98 %		

AMERI SCI

America's Laboratory

CHAIN OF CUSTODY RECORD

AMERI SCI RICHMOND 108061340
Job No.:

10F2

AmeriSci Richmond

13635 Genito Road

Midlothian, VA 23112

Phone: (804) 763-1200

Fax: (804) 763-1800

Toll Free: (800) 476-5227

www.amerisci.com

JDot Project # 0122-033-103-R201

EnviroCheck, LLC		375 Mountain Lane Tazewell, VA 24651	P.O. #:	SPECIAL INSTRUCTIONS: <i>Composite all Positive Stop - DW/TC samples</i>						
PROJECT INFORMATION		ANALYSIS TYPE	TURNAROUND TIME (X)						AIR FILTER INFORMATION:	
JOB #:	<i>E3-20</i>	TEM/AHERA	6-8 HR	12 HR	24 HR	48 HR	72 HR	5 DAY	OTHER	MCE
JOB NAME.:	<i>County of Franklin</i>	TEM/LEVEL II								PC
JOB MANAGER:	<i>JL RHUDY III</i>	TEM/7402								25 mm
JOB DESCRIPTION:	<i>D-1, Parcel 004 County of Franklin</i>	TEM/BULK								37 mm
		TEM/DUST								0.45 um
		TEM/WATER								0.80 um
		PLM							X	OTHER:
		PCM								
		OTHER:								
RESULTS TO: J.L. RHUDY, III		INVOICE TO: ENVIROCHECK, LLC						Return Samples: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
EMAIL RESULTS: Y / N <i>JLLESLIE1@EARTHLINK.NET</i>								PHONE: (276) 472-2174		
WRITTEN REPORT TO:								FAX: (276) 472-2425		
COMMENTS:								SITE FAX:		
								PAGER/CALL:		
Lab ID	Sample ID	Sample Location		START TIME	STOP TIME	TOTAL TIME	X LITERS /MIN.	= TOTAL VOLUME	DATE COLLECTED	
	0-1, 13, 3 K. layer 1+2 Solder									
	4, 5, 6 K. layer 3 tity									
	7, 8, 9 wall plaster									
	10, 11, 12 Ceiling Plaster									
	13, 14, 15 Dull tape									
	16, 17, 18 Window Glaze									
	19, 20, 21 Window Caulk									
	22, 23, 24 Sink Caulk									
	25, 26, 27 Sink Backward Glue									
	28, 29, 30 2nd layer DW									
	31, 32, 33 DE ceiling texture									
	34, 35, 36 LR plaster/Ceiling Texture									
	37, 38, 39 Wall Texture									
	40, 41, 42 Insulation									
	43, 44, 45 1st 1 Ceiling Texture									
	46, 47, 48 BC#1 wall board									
	49, 50, 51 Bath bl + glue									
	52, 53, 54 Wall tile glue									
	55, 56, 57 Tub Caulk									
	58, 59, 60 Ceiling plaster									
	60, 61, 62 Ceiling glue									
	64, 65, 66 Painted ceiling									
	67, 68, 69 Hallway ceiling under tile									
SAMPLED BY:	<i>JL Rhudy III</i>	DATE/TIME:	6-8-08	RECEIVED BY:	<i>REC'D BY</i>				DATE/TIME:	
RELINQUISHED BY	<i>JL Rhudy III</i>	DATE/TIME:	6-8-08	RECEIVED IN LAB BY:	<i>REC'D BY</i>				DATE/TIME:	

REC'D BY
JUN 01 2008
By

AMERI SCI

America's Laboratory

CHAIN OF CUSTODY RECORD

AMERI SCI RICHMOND
Job No.:

108061349

20P2


AmeriSci Richmond

13635 Genito Road
Midlothian, VA 23112
Phone: (804) 763-1200
Fax: (804) 763-1800
TOLL FREE: (800) 476-5227
www.amerisci.com

<i>E3-20</i> EnviroCheck, LLC		375 Mountain Lane Tazewell, VA 24651		P.O.#: SPECIAL INSTRUCTIONS:					
PROJECT INFORMATION		ANALYSIS TYPE	TURNAROUND TIME (X)						AIR FILTER INFORMATION:
			6-8 Hr	12 Hr	24 Hr	48 Hr	72 HR	5 DAY	
JOB #:		TEM/AHERA							MCE
JOB NAME:		TEM/LEVEL II							PC
<i>Carver op Franklin</i>		TEM/7402							25 mm
JOB MANAGER:		TEM/BULK							37 mm
<i>JL Rhudy</i>		TEM/Dust							0.45 um
JOB DESCRIPTION:		TEM/WATER							0.80 um
		PLM							OTHER:
		PCM							
		OTHER:							
RESULTS TO: J.L. RHUDY, III			INVOICE TO: ENVIROCHECK, LLC			Return Samples: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			
EMAIL RESULTS: Y / N <i>JLLESLIE1@EARTHLINK.NET</i>						PHONE: (276) 472-2174			
WRITTEN REPORT TO:						FAX: (276) 472-2425			
COMMENTS:						SITE FAX:			
						PAGER/CELL:			
Lab ID	Sample ID	Sample Location	Start Time	Stop Time	Total Time X	Liters /Min.	Total Volume	Date Collected	
D-1	70, 71, 72 PR Linoleum								
	73, 74, 75 PL Wall/Ceiling Plaster								
	76, 77, 78 Bath Ceiling Texture								
	79, 80, 81 Sink Caulk								
	82, 83, 84 BL#2 CB								
	85, 86, 87 WP - BL#2								
	88, 89, 90 BL#3 CB								
	91, 92, 93 Upstairs Gdry C. Board								
	94, 95, 96 WP								
	97, 98, 99 Carpet Padding								
	100, 101, 102 Window Glass								
	103, 104, 105 Lower Chimney Sealant								
	106, 107, 108 AC. Caulk								
	109, 110, 111 Black Sealant								
	112, 113, 114 Euc/Chimney Sealant/Flooding								
	115, 116, 117 Window Glass								
	118, 119, 120 Wood/Black Caulk								
	121, 122, 123 Small Bed Window Glass								
	124, 125, 126 TP								
	127, 128, 129 Old caulk behind AC Plastic								
	130, 131, 132 Duct Tape Repair								
SAMPLED BY: <i>JL Rhudy</i>			DATE/TIME: <i>6/20</i>		RECEIVED BY: <i>Bob G</i>		DATE/TIME: <i>JUN 1 2008</i>		
RELINQUISHED BY: <i>JL Rhudy</i>			DATE/TIME: <i>6/20</i>		RECEIVED IN LAB BY: <i>By</i>		DATE/TIME:		

APPENDIX IV
Laboratory Accreditation

United States Department of Commerce
National Institute of Standards and Technology

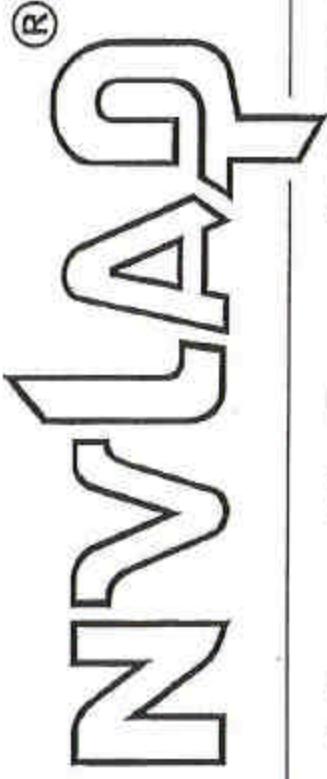

Certificate of Accreditation to ISO/IEC 17025:2005

NVLAP LAB CODE: 101904-0

AmeriSci Richmond
Midlothian, VA

is accredited by the National Voluntary Laboratory Accreditation Program for specific services,
listed on the Scope of Accreditation, for:

BULK ASBESTOS FIBER ANALYSIS

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2005.
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality
management system (refer to joint ISO/ILAC-IAF Communique dated 18 June 2005).



2007-07-01 through 2008-06-30

Effective dates

Daryl S. Bruce
For the National Institute of Standards and Technology

APPENDIX V
Inspectors License

DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION
COMMONWEALTH OF VIRGINIA

3560 Mayfield Dr., Suite 400, Richmond, VA 23235
Telephone: 1 (804) 367-8500

ENTRIES ON

01-31-2009

3303 001729

VIRGINIA ASBESTOS LICENSE
INSPECTOR LICENSE

JACOB L RHUDY III
RT 3 BOX 795-A

TAZEWELL, VA 24651

RECEIVED ON THIS DOCUMENT AND APPROVED FOR PUBLICATION, ON THIS DATE, BY THE DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION.
SHEA, REVERSE SIDE FOR NAME AND/OR ADDRESS CHANGE
RECEIVED ON THIS DOCUMENT AND APPROVED FOR PUBLICATION, ON THIS DATE, BY THE DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION.

COMMONWEALTH OF VIRGINIA
VIRGINIA ASBESTOS LICENSE
INSPECTOR LICENSE

NUMBER: 3303 001729 EXPIRES: 04-31-2009

JACOB L RHUDY III
RT 3 BOX 795-A

TAZEWELL, VA 24651

RECEIVED ON THIS DOCUMENT AND APPROVED FOR PUBLICATION, ON THIS DATE, BY THE DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION.



Jay W. DeBoer
DeBoer, Director



APPENDIX VI
Abatement Cost Estimate